

3.0基站产品测试 - 错误 #3167

[3.0产品测试]3.0.1pre1_T3 小区激活失败，DU产出系列报错后return

2025-04-16 14:45 - 刘 抒放

状态:	已解决	开始日期:	2025-04-16
优先级:	普通	计划完成日期:	
指派给:	赵 晓辉	% 完成:	0%
类别:		预期时间:	0.00 小时
目标版本:		耗时:	0.00 小时
问题归属:	DU, 系统	目标解决问题版本:	Rel_3.0.1
发现问题版本:	Rel_3.0.1		

描述
测试设备：192.168.8.163 基站板卡+兴悦达3.5G功放整机 问题现象：升级3.0.1Pre1_T3后，小区激活du侧显示如图错误后return出来。同配置T2可激活。 报错如下： ldconfig: /lib/libatomic.so.1 is not a symbolic link ldconfig: /lib/libatomic_ops_gpl.so.1 is not a symbolic link ldconfig: /lib/libpcrc.so.1 is not a symbolic link ldconfig: /lib/libsysrepo.so.5 is not a symbolic link ldconfig: /lib/libatomic_ops.so.1 is not a symbolic link ldconfig: /lib/libxml2.so.2 is not a symbolic link ldconfig: /lib/libyang.so.1 is not a symbolic link rm: cannot remove 'msgdump*': No such file or directorTy rm: cannot remove 'du_dbg_log*': No such file or diredtory rm: cannot remove 'du_mem_log*': No such file or diredtory !! sysrepo_start OAM_AGENT_READ_CONFIG_STARTED [INF]: Scheduled changes not applied because of otherexisting connections. [INF]: Connection 2 created. [INF]: Session 43 (user "root", CID 2) created. get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PRRU_TX_FREQ = 3350820000 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PRU_RXFREQ = 3350820000 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PRU_AUXFREQ = get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PRU_TX_MAX_POWER = 430 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PRU_RX_GAIN = 255 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PRU_SAWIPLE_RATE = 122880000 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PRU_VWIDEBAND = 100000000 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PRRU_TX_ANTNUMBER = 4 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PRUTRANS_MODE = 0 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PPRU_ORX_ENABLE = 0 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PRU_204C_ENABLE = 0 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PRU_UCCPIOG_ENABLE = 0 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PA_FREQ = 600000000 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PACHANNEL = 17 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PA_CHANNEL_ATT1 = 150000000 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PA_CHAANNEL ATT2 = 14500000 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PA_CHAANNEL ATT3 = 14500000 get_cell_config /du-cell:DU-CELL/PRU_CONFIG/NR_CELL_PAA_CHANNEL_ATT4 = 16450000 gen_running_rfic_cfg_file_path: load file error!

历史记录

#1 - 2025-04-16 14:46 - 刘 抒放
研发已定位，需替换board.cfg文件进入firemwre文件夹中，此单待T4升级后无问题则关闭

#2 - 2025-04-22 16:04 - 周 立伟
- 状态从 新建 变更为 已解决

将board.cfg文件放到了phy文件下，下个版本T4生效。已验证通过